SECTION 5-B

TWIN TURBINE TRANSMISSION TROUBLE DIAGNOSIS—

ADJUSTMENTS ON CAR

CONTENTS OF SECTION 5-B

Paragraph	Subject	Page	Paragraph	Subject Subject	Page
5-9	Transmission Test and		5-11	Location and Correction of	
	Inspection	5-28		Transmission Oil Leaks	5-31
5-10	Transmission Operational Faults		5-12	Transmission Manual Control	
	Causes and Corrections	5-29		Mechanism and Linkage	
				Adjustments	5-33

SERVICE OPERATIONS IN OTHER SECTIONS

Paragraph			
Checking Transmission Oil Level 1-3 Drain and Refill Transmission 1-6	Throttle Linkage and Dash Pot Adjustments	3-9	
	Neutral Safety Switch Adjustment	10-43	

5-9 TWIN TURBINE TRANSMISSION TEST AND INSPECTION

a. Road Test

When improper operation of a Twin Turbine transmission is reported, time and expense will usually be saved by first making a thorough road test to observe operation in all ranges under appropriate driving conditions. The road test will also serve to thoroughly warm up the transmission, which is required for any tests made in the shop.

The person making the road test should be familiar with the operation and performance of Twin Turbine transmission in all ranges so that he will be able to detect any sub-standard condition. The required "feel" of a Twin Turbine equipped car can best be acquired by driving through a test routine on a number of cars whose performance is known to be satisfactory. Knowledge of which parts are in operation and which hydraulic controls govern operation in each range is essential to intelligent diagnosis, therefore, a study of paragraphs 5-4 through 5-12 is recommended

After the transmission has been warmed up to normal operating temperature, thoroughly test operation in all ranges, making tests on steep grades as well as on level road, if possible. While in Direct Drive test shifting of the two position stator by pressing accelerator pedal to floor mat a number of times. A slight surge or change of engine speed accompanied by acceleration pick-up should be noted, indicating that the stator has shifted to the high angle position.

Test operation when shifting between Low and Direct Drive under load, also test operation in Direct Drive after extended operation in Reverse. Check for abnormal slip or overrun of the engine on low speed acceleration. With car stopped on level road and brakes released, check for creep when engine is accelerated with transmission in Neutral. Check for abnormal creep with engine idling and transmission in each of the driving ranges.

Place transmission in Direct Drive and firmly apply the brakes. Snap the throttle open to give engine speed of approximately 1400 RPM and immediately release the accelerator pedal. If the engine returns to idle too slowly, or else returns to idle so fast that it either stalls or rolls unevenly, improper throttle linkage and dash pot adjustment is indicated. Rough operation on idle after slow deceleration indicates the need for some engine tune up adjustments.

During all tests, be alert for any unusual or abnormal noises. Carefully note the range, speed and other conditions under which the noise is evident.

b. Shop Inspection and Test

After the road test described above, a number of shop inspections and tests should be made while the transmission is thoroughly warmed up to operating temperature.

(1) Check Oil Level. In every case of a transmission complaint first check the oil level as described in paragraph 1-1 (Step 7). If oil level is low bring it to proper level and check the effect on operation before doing further work. If oil level is low and the car history indicates oil loss of one pint or more per 1000 miles, or transmission exterior is oily,

a thorough inspection for oil leakage should be made as described in paragraph 5-11.

- (2) Check Manual Control Linkage. In cases of improper operation in one or more ranges it is always advisable to check the adjustment of transmission manual control linkage as described in paragraph 5-12.
- (3) Test Oil Pressures in Hydraulic Control System. When diagnosing almost all cases of improper operation it is necessary to have accurate knowledge of oil pressures in the hydraulic control system. The following oil pressure tests should be made before performing any mechanical work.
- (4) Check Engine and Transmission Mountings. Check the engine and transmission mounting bolts and condition of the rubber mountings. Also check for any marks on the converter housing, transmission case or oil pan that would indicate that these parts had been damaged by some obstruction, which might affect alignment of the transmission.

c. Testing Hydraulic Control Oil Pressures

Before making the pressure tests oil level must be correct (par. 1-1, Step 7) and the transmission must be thoroughly warmed up to operating temperature. Place rear end of car solidly on car stands or use a free wheel type hoist so that plugged ports can be reached and transmission can be operated with rear wheels free to turn.

Remove pipe plug at the following points in turn and connect Pressure Gauge J-2575. (1) Front oil pump, on left side of transmission case. (2) High or low accumulator, on front upper corner of accumulator body. (3) Stator, on left end of reaction shaft flange. See Figure 5-26.

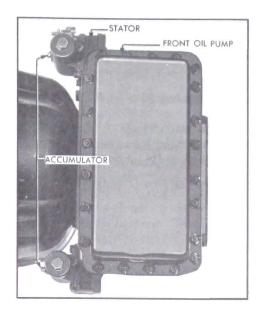


Figure 5-26—Gauge Connections for Oil Pressure Tests

Run engine at 500 RPM and test pump and accumulator pressures in Low, Drive and Reverse. Test front oil pump in all ranges. Test high accumulator only in Drive and test low accumulator only in Low. Repeat tests at 1000 RPM and 1800 RPM in Low and Drive only. The following pressures should be obtained on these tests.

Engine	Trans.	Front	Accumu-	Stator
RPM	Range	Pump	lator	(min.)
500	Low	120	115	10
	Drive	90	80	10
	Reverse	120	-	-
1000	Low	180	1 <i>7</i> 5	65
	Drive	90	85	65
1800	Low	180	1 <i>7</i> 5	75
	Drive	90	85	75

Low or erratic oil pump pressure indicates an air leak into the pump suction line, faulty pressure regulator valve operation, or excessive clearance in pump.

Very low accumulator pressure may be caused by external or internal leakage past the accumulator body gasket. A difference of more than 10 psi between front pump and an accumulator indicates an excessive leak between the accumulator and the clutch (if high accumulator pressure is low) or the low servo (if low accumulator pressure is low), or else the

metering orifice in accumulator is restricted or plugged.

With the results of the road test and the pressure tests in mind, the cause of improper operation in most cases can be ascertained by using the suggestions given under the following paragraph 5-10.

5-10 TWIN TURBINE TRANSMISSION OPERATION FAULTS, CAUSES AND CORRECTIONS

Where paragraph numbers in parenthesis () are shown they refer to other paragraphs in this manual where the required adjustment or repair procedure is given.

a. Engine Stalls while Decelerating Car with Brakes Applied

- (1) Improper adjustment of throttle dash pot (par. 3-9).
- (2) Engine not properly tuned (par. 2-9).

b. Transmission Oil Foams and Spews Out of Breather

- (1) Water in transmission, indicated by overfilled condition and caramel color of transmission oil. Water in transmission usually comes from a leaking oil cooler. In this case there may be excessive oil accumulation in top tank of the engine radiator. Correct the cause of leakage, and completely drain and refill transmission (par. 1-4).
- (2) Air leak into hydraulic system at rear oil pump gaskets (par. 5-14).

c. Car Will Not Move in Any Range—Rear Wheels Free

(1) If car will not move for 1 to 8 minutes after standing over night, park car for several hours with

engine stopped and then check front oil pump pressure. A zero reading until such time as car will move indicates that front pump loses its prime due to excessive clearances. Inspect front pump (par. 5-18). If condition has existed for some time it is advisable to inspect clutch and bands for excessive wear due to slippage at low apply pressure (par. 5-20).

(2) If car will not move in any range after extended operation in Reverse it indicates air leakage into pump suction line and excessive clearance at front oil pump. Front oil pump pressure will be very low during period when car will not move. Inspect for air leaks at rear oil pump gaskets (par. 5-14). Inspect front oil pump and cover for excessive clearances (par. 5-18).

d. Car Will Not Move in Any Range—Rear Wheels Locked

- (1) Parking lock engaged or parking brake applied.
- (2) Lock up due to broken part in rear axle or transmission.

e. Car Will Not Move in Direct Drive Only

- (1) If front oil pump and high accumulator pressures are OK, remove and inspect clutch assembly (par. 5-20).
- (2) If front oil pump pressure is OK but high accumulator pressure is low and accumulator body gasket is not leaking internally, inspect for leaks in reaction flange gasket. If gasket is satisfactory, inspect clutch piston outer seal and ball check, also oil sealing rings on hubs of reaction shaft flange and low drum (par. 5-20).

f. Car Will Not Move in Reverse Only

(1) Reverse servo inoperative (par. 5-17).

(2) Band improperly adjusted (par. 5-23) or band operating strut has dropped out of place.

g. Excessive Slip in All Ranges

- (1) If condition occurs only after operation in Reverse, see subparagraph c (2) above.
- (2) Low oil level (par. 1-1).
- (3) Manual control linkage improperly adjusted (par. 5-12).
- (4) If front oil pump pressure is low, remove and inspect pressure regulator valve and all valve and servo body gaskets (par. 5-17). If cause is not found remove and inspect front oil pump for wear or excessive clearances (par. 5-18). Inspect pump cover and reaction shaft flange gaskets for leaks.

h. Excessive Slip in Direct Drive Only

- (1) Manual control linkage improperly adjusted (par. 5-12).
- (2) Leak at high accumulator gasket, indicated by low oil pressure at high accumulator.
- (3) If above items are OK, remove and inspect clutch plates, sealing rings, and clutch piston. Inspect for stuck check ball in piston (par. 5-20).

i. Excessive Slip in Low Only

- (1) Manual control linkage improperly adjusted (par. 5-12).
- (2) Low band improperly adjusted (par. 5-23).
- (3) If pressure at low accumulator is low, check for leak at accumulator body gasket. If gasket is OK remove valve and servo body and check for gasket leaks and condition of low servo piston seal (par. 5-17).

(4) Low band and drum scored or worn.

j. Excessive Slip in Reverse Only

- (1) Manual control linkage improperly adjusted (par. 5-12).
- (2) Reverse band improperly adjusted (par. 5-23). Check for strut out of place or broken anchor.
- (3) If front oil pump pressure is low remove valve and servo body and check for gasket leaks and condition of reverse servo piston seal (par. 5-17).
- (4) Reverse band and ring gear scored or worn.

k. Car Creeps Forward in Neutral

- (1) Manual control linkage improperly adjusted (par. 5-12).
- (2) Remove valve and servo body and check for low servo piston sticking up.
- (3) Remove clutch and inspect for sticking, warped or improperly assembled clutch plates. Note whether "dish" of steel plates is in same direction on all plates. If creep occurs only when engine is accelerated to approximately 2500 RPM, pay particular attention to condition of check balls at vents in clutch piston and reaction shaft flange (par. 5-20).

I. Car Creeps Forward in Reverse or Backward in Low

Manual control linkage improperly adjusted (par. 5-12).

Low to Direct Shift Abnormally Rough, or Slip Occurs

(1) If high accumulator pressure is low remove accumulator and check body gasket. Check for accumulator piston sticking down.

Top land of piston must be fully visible through top port in body (par. 5-19).

- (2) If accumulator and gasket are OK, inspect for leaks in valve and servo body gaskets.
- (3) Low band improperly adjusted (par. 5-23).
- (4) Binding or worn clutch plates (par. 5-20).

n. Excessive Chatter or "Clunk" When Starting in Low or Reverse

NOTE: A very slight chatter just as car starts to move in reverse, which disappears as soon as car is in motion, may be considered normal. A slight "clunk" when shifting into Low or Reverse is also normal.

- (1) Check engine and transmission mountings for tightness. Inspect for broken rubber thrust pad at transmission mounting.
- (2) Low or Reverse band improperly adjusted (par. 5-23).
- (3) If (1) and (2) do not correct trouble, direct drive clutch may be dragging. Remove clutch and inspect for sticking, warped, or improperly assembled clutch plates. Note whether "dish" of steel plates is in same direction on all plates (par. 5-20).
- (4) Inspect for excessive wear of reverse ring gear bushing. Check for foreign matter in planet pinion needle bearings (par. 5-22).

o. Noises in Transmission

When diagnosing abnormal noises in the transmission consideration should be given to the parts that are in motion when the noise occurs. The presence or absence of noise in each range should be noted so that the parts which cause the noise can be determined by a process of elimination.

A hum or low whine in Neutral or Parking is normal since all

planetary gears are free to rotate without the steadying effect of a load. Some hum also may be expected in Low and Reverse.

A low growl in transmission which disappears in several minutes after engine is started, following extended parking in extremely cold temperatures is caused by cavitation of the cold oil. This is a normal condition which requires no correction.

A buzzing noise can be caused by low oil level, or by the front pump delivery check valve seating on the edge of the gasket between valve and servo bodies. A buzzing noise, noticeable in Parking and Neutral, may be caused by excessive clearance of pressure regulator valve in valve body or an oversize orifice in valve land; correction requires replacement of valve.

A clicking noise in all ranges may be caused by a foreign object going through the converter. A clicking noise only when car is in motion may be caused by the parking lock pawl contacting the ratchet wheel due to improper manual control linkage adjustment.

Abnormal hum or whine which occurs in all ranges may be attributed to worn parts or excessive clearances in the front oil pump. Noise caused by the front pump will increase in Low and will diminish at car speeds above 45 MPH in Direct Drive. It increases and decreases with engine speed in all ranges. When excessive clearance exist in front oil pump the pressure test will usually indicate low front pump pressure.

Abnormal hum or whine in all ranges but Direct Drive may be attributed to conditions in the planetary gear train since these gears are locked in Direct Drive but either idling or transmitting power in all other ranges.

Squealing or screeching immediately following installation of front oil pump parts indicates that the driving gear has been installed backwards. This condition should be corrected without further operation of transmission as severe damage will result.

A whistling noise which occurs during low speed acceleration in Drive, Low, and Reverse, accompanied by unsatisfactory transmission performance indicates cavitation of oil due to incomplete filling of torque converter. Remove valve and servo body assembly and check for restrictions in passages leading to torque converter. If these passages are clear, check passages in reaction shaft flange.

A whistling noise which occurs during low speed acceleration in Drive, Low and Reverse but with otherwise satisfactory transmission performance may be caused by thin, weak, or cracked turbine vanes, or vanes which are bent over at the exit edges. Such vanes will vibrate under load, causing a whistle. Replacement of the turbine is required for correction.

5-11 LOCATION AND CORRECTION OF TWIN TURBINE TRANSMISSION OIL LEAKS

If the transmission is found consistently low on oil, indicating loss of 1 pint or more per 1000 miles, a thorough inspection should be made to locate and correct all external leaks. An inspection for external leaks also should be made if the oil pump and accumulator tests described in paragraph 5-9 show low oil pressure, since leaks at some gaskets which affect pressure will show externally.

In some cases, oil leaks which show externally can be corrected without removal of transmission, but in other cases removal is necessary. For this reason it is very important to locate the source of an external oil leak before removal of transmission in order that the cause can be definitely identified during disassembly operations. In the disassembly operations given in Section 5-C, attention is always directed to inspection of each gasket at time of removal since at that time the clues to leakage are clearly shown in the condition of gasket and the imprint of adjoining parts.

For purpose of identification the oil in the Twin Turbine transmission is dyed red in color.

a. Inspection of Transmission for External Leaks

If exterior of transmission is oily, first make certain that the oil is not coming from the engine, since engine oil caught in the air stream will be thrown back over the fransmission. If engine upper or lower crankcase is wet with oil, thoroughly wash and dry, then run engine until cause of engine oil leakage is found and corrected.

To check for transmission oil leakage place car on high car stands or a free wheel type hoist so that engine and transmission can be operated with rear wheels free and transmission can be inspected.

Remove the converter housing hand hole cover. Thoroughly clean the inside of bell housing and surfaces of flywheel and primary pump as far as possible. Use carbon tetrachloride or other non-inflammable quickdrying cleaner. It is impossible to locate the source of an oil leak unless all visible surfaces are clean and dry.

Start engine and operate transmission in Direct Drive until transmission is warmed up or until an oil leak becomes evident. Thoroughly inspect for evidences of fresh oil at the following points.

- (1) Low and Reverse adjustment hole cover.
- (2) Oil gauge rod filler pipe to pan fitting.
- (3) Rear bearing retainer at flanges, cross shaft bearing seal and companion flange seal.
- (4) Oil Pan.
- (5) High and low accumulator plugs, caps and body gaskets.
- (6) Reaction shaft flange to front oil pump cover and to transmission case gaskets.
- (7) Face of flywheel and interior of converter housing.

Even though oil does not show in interior of converter housing check for oil leaks at primary pump cover and at front oil pump. To check primary pump cover hold a piece of white paper or cardboard between flywheel and converter housing. To check front oil pump insert a long roll of paper through opening toward the pump. If oil is leaking at either place oil spray will be visible on the paper.

After inspecting transmission while operating in Direct Drive shift to Low, run engine at 1000 RPM and repeat the inspections outlined. The higher pump pressure existent in Low may cause a leak to show that would not be evident at the lower pressure existent in Direct Drive.

b. Oil Leaks at Adjustment Hole Cover or Oil Gauge Rod Base

A leak at an adjustment hole cover may be corrected by removing cover and installing a new cover gasket.

Leaks at junction of filler pipe with oil pan may be corrected by tightening the fitting.

c. Oil Leaks at Rear Bearing Retainer

An oil leak at the cross shaft bearing seal may be corrected by removing the bearing and replacing the seal. Seal must be installed with grooved side facing inward.

If oil leaks at joint between rear bearing retainer and transmission case tighten the seven 3/8" bolts to 30-40 ft. lbs. torque with transmission hot. If gasket is blown out at the bottom, or tightening of bolts fails to correct leak, the rear bearing retainer must be removed for inspection.

d. Oil Leaks at Oil Pan Gasket

If oil leaks at oil pan gasket carefully tighten all bolts and nuts to 10-12 ft. lbs. torque. If bolts and nuts are tight, or tightening fails to correct the leak, remove pan for inspection.

Remove old gasket and clean oil pan thoroughly. Inspect pan for cracks or other damage, and check mounting flange with straight edge. If pan is cracked or flange is uneven and cannot be trued up satisfactorily, replace oil pan.

Install old or new pan and after transmission is warmed up again tighten bolts and nuts to 10-12 ft. lbs. torque.

e. Oil Leak at Accumulator

If oil is leaking around accumulator cap remove cap and coat threads with Permatex No. 3. Install cap with a new gasket and tighten to 40-50 ft. lbs. torque.

If oil is leaking at accumulator body gasket, inspect for broken flange on body. Replace accumulator if flange is broken, otherwise tighten bolts and nuts to 20-25 ft. lbs. torque. If leak con-

tinues, remove accumulator for inspection. Inspect gasket for condition and imprint of accumulator body. Test mounting surface of accumulator body with straight edge and if it is uneven disassemble accumulator and true up the surface as described in paragraph 5-19. If body is porous or cracked replace accumulator assembly. Reinstall accumulator with new gasket placed so that small drain hole lines up with drain hole in reaction shaft flange, then tighten bolts and nuts to specified torque.

f. Oil Leaks at Reaction Shaft Flange or Front Oil Pump Cover

If oil leak is at gasket between reaction shaft flange and transmission case tighten accumulator bolts to 25 ft. lbs. torque. If leak is at gasket between the flange and the front oil pump cover tighten the bolts and nut at outer lower corners of pump cover. If tightening does not correct the leak it will be necessary to remove transmission for inspection of parts at this point.

g. Oil Leaks in Interior of Converter Housing

An oil leak showing on front side of flywheel is probably caused by loose converter drain plugs which must be tightened. If plugs are not leaking check for leakage past the crankshaft rear bearing.

If an oil leak at converter pump cover is indicated by the test with paper (subpar. a), tighten all converter pump cover bolts to 25-30 ft. lbs. torque, following the sequence shown in Figure 5-107. If this fails to correct the leak it will be necessary to remove the transmission for inspection of parts at this point.

If an oil leak at front oil pump is indicated by the test with paper it will be necessary to remove the transmission for inspection of front oil pump and converter pump hub. Before removing transmission, wash and dry the interior of converter housing again, then run in Direct Drive until the first indication of oil appears on the roll of paper and shut off engine. This procedure will leave a clean oil marking at the source of the leak which will aid in correction when transmission is disassembled at front oil pump.

h. Internal Oil Leaks

Internal oil leaks which affect transmission operation are indicated by the oil pump and accumulator pressure tests described in paragraph 5-9.

Since low pump or accumulator pressure can be caused by faulty pressure regulator valve operation or leaks at joints between the valve body, servo body, and transmission case it is advisable to first remove the valve and servo body assembly for inspection as described in paragraph 5-17. This can be done without removal of transmission. It is also advisable to check the condition of accumulator body gasket. If the cause of the internal leak is not disclosed by this work it will be necessary to remove the transmission for inspection of pumps and direct drive clutch.

5-12 TWIN TURBINE TRANSMISSION MANUAL CONTROL MECHANISM AND LINKAGE ADJUSTMENTS

a. Stator Control Linkage

Stator operation is controlled by a valve in the high accumulator which is operated through external linkage by the throttle linkage at wide open throttle position. Since proper adjustment of the stator control linkage is dependent upon proper adjustment of throttle linkage, all adjustments are covered together in paragraph 3-9.

b. Shift Control Linkage

The shift control lever mounted in the housing at upper end of steering column jacket operates a tubular control shaft located inside the column jacket. When the lever is pulled upward toward the steering wheel the lever stop pin is disengaged from a stop plate in the shift lever housing. The control shaft can then be rotated by movement of the control lever. The control shaft lower lever operates the transmission shift lever through connecting rods and an idler lever mounted on car frame.

The shift lever operates a cross shaft inside the rear bearing retainer, from which linkages connect to the shift control valve and the parking lock pawl. A spring loaded detent lever and roller engages notches in a detent plate on the cross shaft to hold the control valve in any set position.

c. Shift Control Linkage Adjustments

When a Twin Turbine transmission does not operate properly it is advisable to first check the shift control linkage adjustment, after checking to be sure oil is at proper level. The shift control linkage may be easily checked as follows:

- 1. With manual control lever in Park position, raise car to allow access to lower linkage.
- 2. Loosen clamp nut at lower end of upper rod. Move lever several times to be certain lever is in "Park" detent.
- 3. Tighten clamp nut.

- 4. Check adjustment. Distance from drive detent to drive stop should be approximately equal to distance from low detent to low stop.
- 5. Check dial pointer adjustment. If pointer does not line up with "D" on dial with selector in drive detent, adjust pointer as described in subparagraph d below.
- 6. With transmission warmed up and engine idling at approximately 600 RPM, slowly move control lever from Neutral (N) to Drive (D) position. The clutch should engage, as indicated by an immediate decrease in engine speed


- when the pointer is midway between "N" and "D" on speed ratio dial.
- 7. Slowly move control lever from Drive (D) position to Neutral (N) position. Clutch should disengage, as indicated by an immediate increase in engine speed, when center of speed ratio pointer is midway between "D" and "N" on speed ratio dial.
- 8. If points of clutch engagement and disengagement are not as specified, and all preceding linkage adjustments have been correctly made, it will be necessary

to remove transmission oil pan and adjust the position of the shift control valve as shown in Figure 5-27, observing instructions in the related text.

d. Twin Turbine Transmission Dial Pointer Adjustment

- 1. Remove lower steering column housing.
- 2. Either loosen dial pointer set screw or carefully bend pointer to line up pointer with "D" in Drive range. Tighten set screw.

35

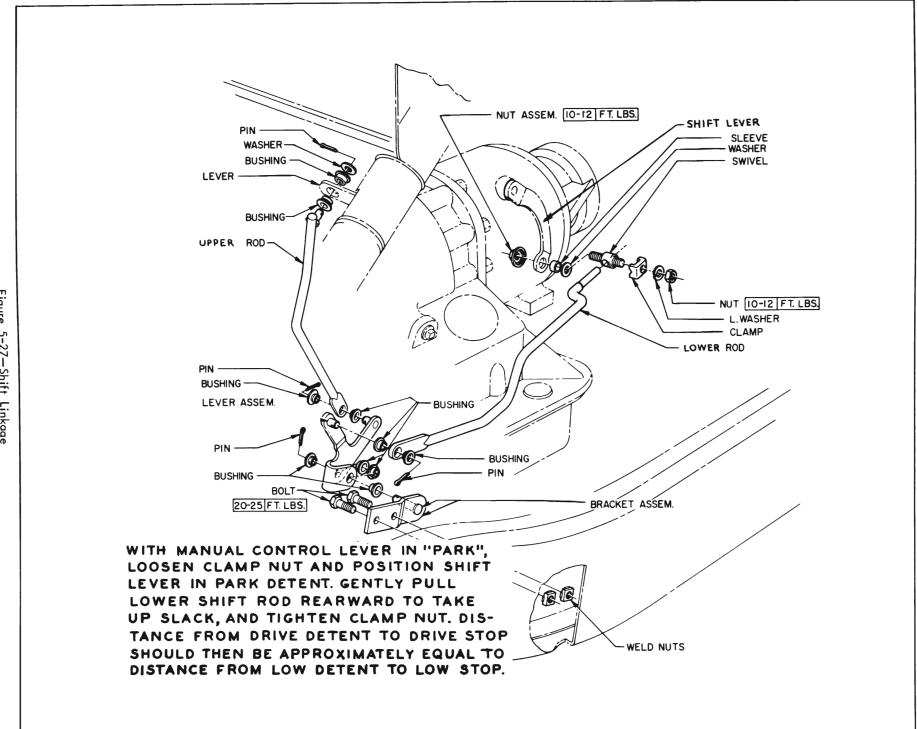

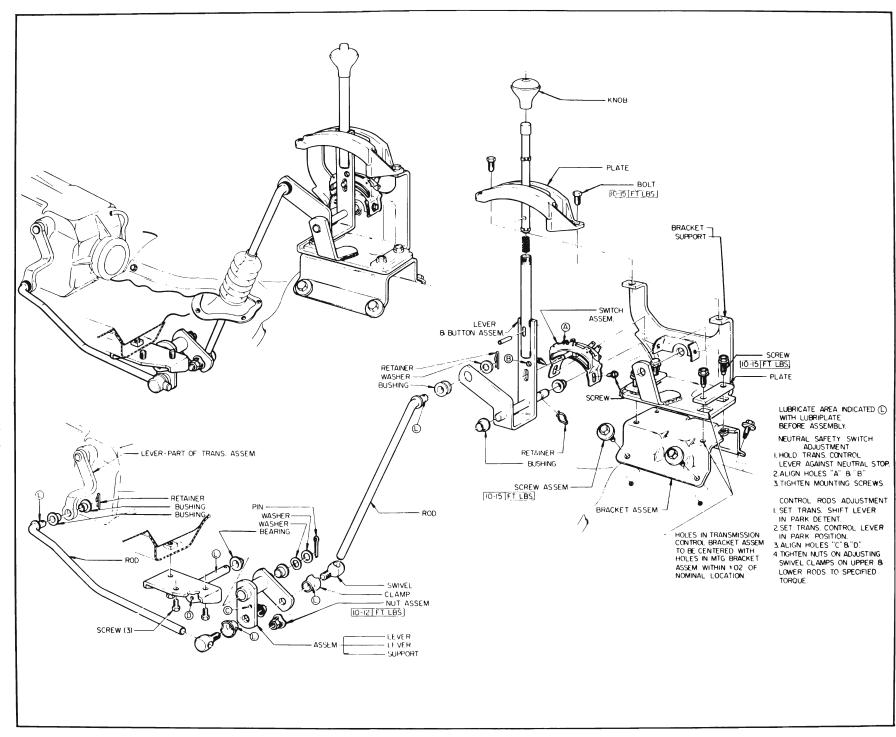


Figure 5-28—Wildcat Shift Linkage

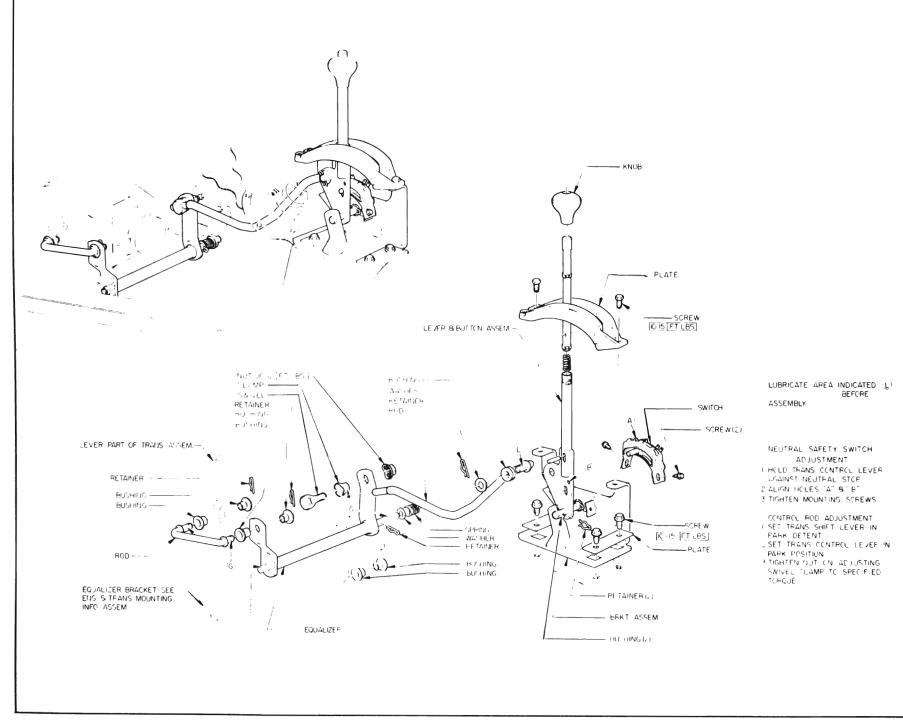


Figure 5–29—Shift Linkage—4700 Series